



TECHNICAL ADVISORY BULLETIN

Cleancut pump A2EA-6527

This bulletin advises that Cleancut pumps A2EA-6527 manufactured during months March, April and May 2016 might present a tightness issue on Inlet/Return 1/4-18 NPTF plugs.

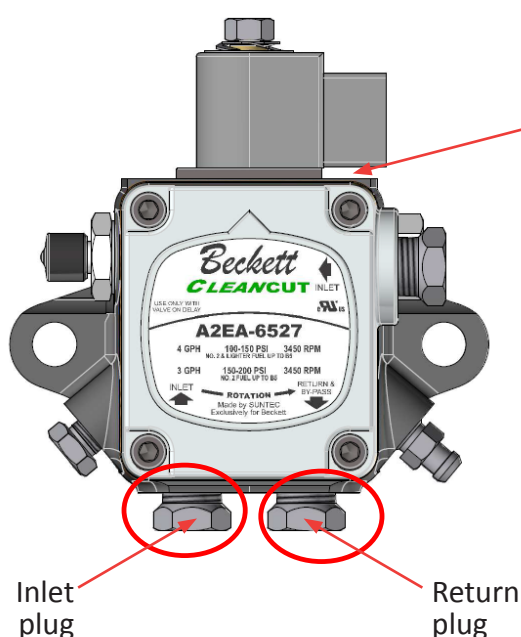

In order to identify such pumps, it is necessary to check the date stamped on the top of the body :

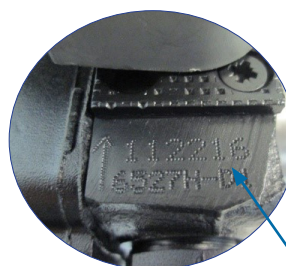

Date code : **MMDDYY**
(112216 = Nov. 22, 2016)

1. Before starting your burner, confirm the pump is not in the affected date range. If the unit is in the date range, follow steps 2 and 3.
2. Carefully verify the tightness of Inlet/Return plugs.
3. For any recognized or suspected leak, unscrew plugs and apply pipe sealant, and re-insert them with a fitting torque of 12 to 20 Ft.Lbs.